Clarion Co., Ltd.
7-2, Shintoshin, Chuo-ku, Saitama-shi, Saitama 330-0081 Japan
Service Dept.: 7-2, Shintoshin, Chuo-ku, Saitama-shi 330-0081 Japan
Tel: +81-48-601-3705 FAX: +81-48-601-3804

Published by Service Dept.
298-6946-00 Feb.2011
Printed in Japan

Service Manual

PDF MANUAL

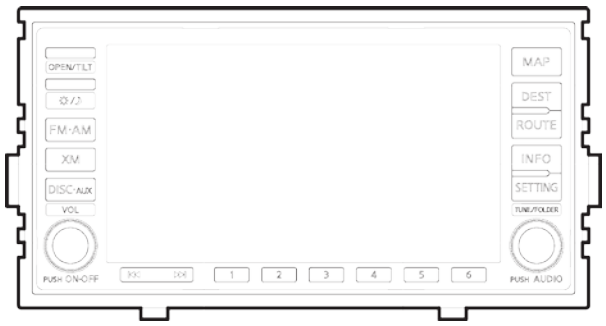

NISSAN Motor Genuine
2DIN HDD Navigation

4CH Pre-out Specifications for North America

Model **UQY5875**
(N# 25915 ZX01B)
(MODEL No. NA7W-8401CA)

Model **UQY5876**
(N# 25915 ZX02A)
(MODEL No. NA7W-8401US0)

Model **UQY5877**
(N# 25915 ZX02B)
(MODEL No. NA7W-8401CA0)

LF

This product is a lead free model.
Lead free solder is used in PWB stamped LF mark.
Please keep the following conditions when you repair.

1. Use lead free solder.
   * Koki's lead free solder S3X-55M 0.6mm
   (CLARION Parts No.642-0231-01)
   * Koki's lead free solder S3X-55M 1.0mm
   (CLARION Parts No.642-0231-02)
2. Use a nitrogen solder system.
3. Do not use "General solder" and "Lead free solder" together.

ORIGINAL SERVICE MANUAL

The original model of UQY5875/6/7 is UQY5874. This additional service manual is designed to be used together with the service manual of UQY5874.

Original model	Manual No.
UQY5874	298-6940-00

CONTENTS

1. SPECIFICATIONS..... 2
2. COMPONENT 2
3. NOTES 2
4. To engineers in charge of repair or inspection of our products..... 2
5. CONNECTORS 2
6. ASSEMBLY & PARTS LIST 2
7. BLOCK DIAGRAM 2
8. Differance parts list and supplement assembly 2

1.SPECIFICATIONS

The specifications of UQY5875/6/7 are the same as UQW5874.
Please refer to page 2 of the original manual.

2.COMPONENT

UQY5875(NA7W-8401CA)

1. Main unit ---------- 1

UQY5876(NA7W-8401US0)

1. Main unit ---------- 1

UQY5877(NA7W-8401CA0)

1. Main unit ---------- 1

3.NOTES

The notes are the same as UQY5874's manual.
Please refer to page 2 of the original manual.

4.To engineers in charge of repair or inspection of our products.

The attention points are the same as UQY5874's manual.
Please refer to page 3 of the original manual.

5.CONNECTORS

The connectors of UQY5875/6/7 are the same as UQY5874.
Please refer to page 4 of the original manual.

6.ASSEMBLY & PARTS LIST

The parts written in No.8 are different from the original model.
Other parts are the same as UQY5874.
Please refer to page 6~19 of the original manual.

7.BLOCK DIAGARAM

The block diagram of UQY5875/6/7 is the same as UQY5874.
Please refer to page 20 of the original manual.

8.Differance parts list and supplement assembly.

PAGE	NO.	PART NO.	DESCRIPTION	QT'Y
9	#120	932-0123-81	W-SLIDE-MECH for UQY5876 UQY5877	1
	#121	8829043A	XM-PWB-ASSY for UQY5875 UQY5877	1
10	#125	.9900615A	NAVI-PWB for UQY5876 UQY5877	1
12	#129	331-4940-00	PRESSED PARTS for UQY5876 UQY5877	1
	#131	MQZ0064	UNUSED in UQY5876 UQY5877	1
	#157	MQZ0065	HDD-PM SHEET for UQY5876 UQY5877	2
19	#152	.9900621A	ESCUTCHEON for UQY5876 UQY5877	1
	#153	.9900486A	SHL-PWB for UQY5876 UQY5877	1
	#154	716-3698-00	2.6 x 4 SCREWS for UQY5876 UQY5877	2
21	#209	379-0483-00	LCD Module for UQY5876 UQY5877	1
22	#221	307-0779-00	RR-CASE-AS for UQY5876 UQY5877	1

*About the #157, please confirm to supplement assembly.

Supplement assembly

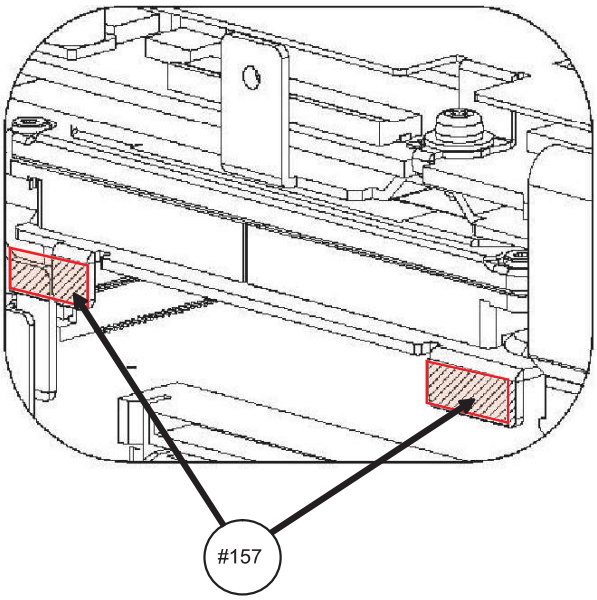

***Paste an interior angle as standard.**

PROCEDURES	Paste the (#157)HDD-PM SHEET to the bent portion of the HDD-BRKT.
NOTICE	*Paste an interior angle as standard.